


CHEETAH

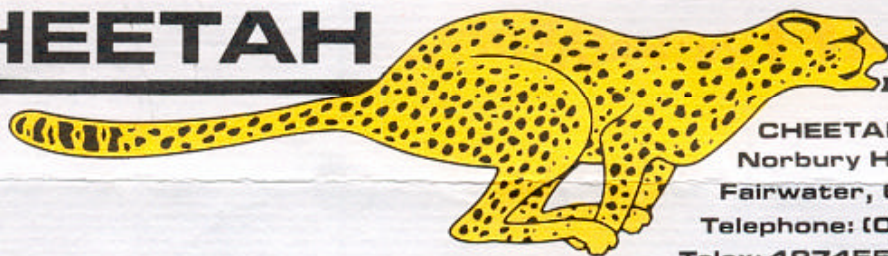

CHEETAH INTERNATIONAL LTD.
Norbury House, Norbury Road,
Fairwater, Cardiff U.K. CF5 3AS.
Telephone: (0222) 555525
Telex: 497455 Fax: (0222) 555527

]1 May 1991

Dear Andy,

Apologies for the delay in replying to your letter, but we have recently moved to new premises in Bedwas. You have a very early version of the MS6 which will not have all the latest modifications. The main mods for hum problems were the removing of the wire running from the earthing tag to the main PCB, this extra earth was found not to be necessary and to cause earth loops with some equipment. The other modification is on the midi in socket. The central pin of the din socket must be removed without damaging the track that runs to it and away to another component. This stops earth problems which only show up through the midi connections.

I hope this helps you but if you require more information, please phone on our new telephone number.

Yours sincerely

A. Rees
for CHEETAH INTERNATIONAL LIMITED